电性参数

Absolute Maximum Rating

光电参数 Ta=25 Optical-electrical parameter

外形尺寸

Outline Dimension

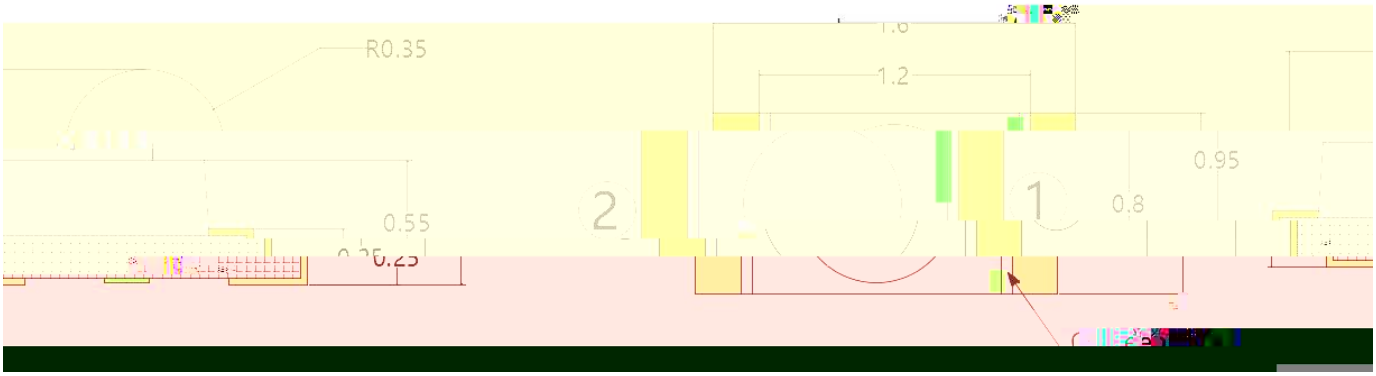

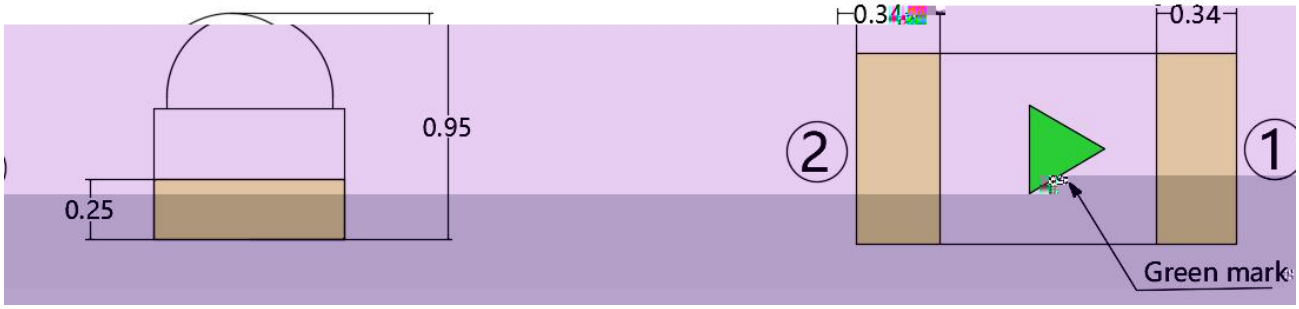

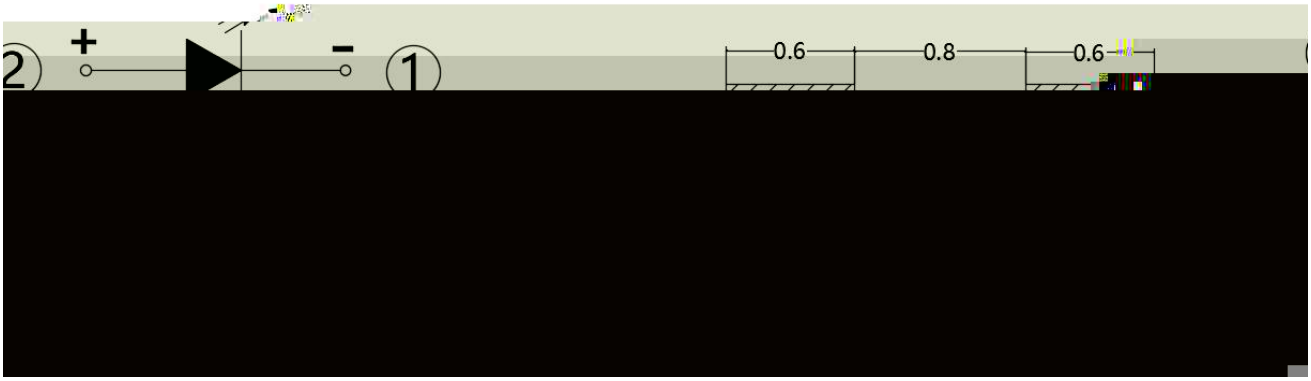

All dimensions are in millimeters.

Tolerance is 0.25mm unless otherwise noted

焊接指导（1）

Guideline for Solder

1. 使用烙铁人手焊接

Hand Soldering

W

300 3

LED

Manual welding is recommended only for repair and heavy industry situations. A soldering iron of less than 30W is recommended to be used in Hand Soldering. Please keep the temperature of the soldering iron under 300 while soldering. Each terminal of the LED is to go for less than 3 second and for one time only.

Be careful because the damage of the product is often started at the time of the hand soldering.

2. 回流焊接

Reflow Soldering: Use the conditions shown in the under Figure of Pb -Free Reflow Soldering.

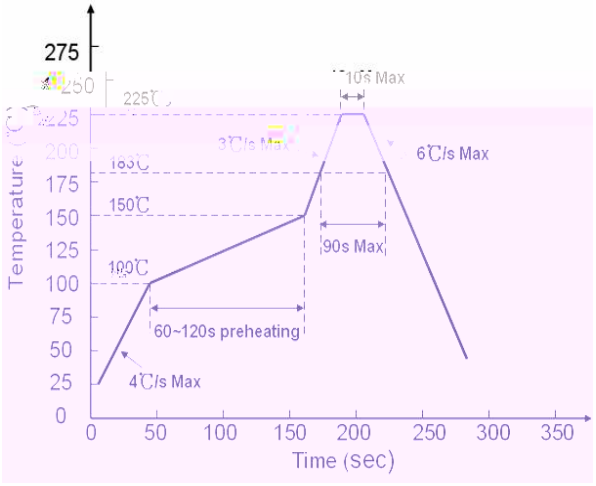

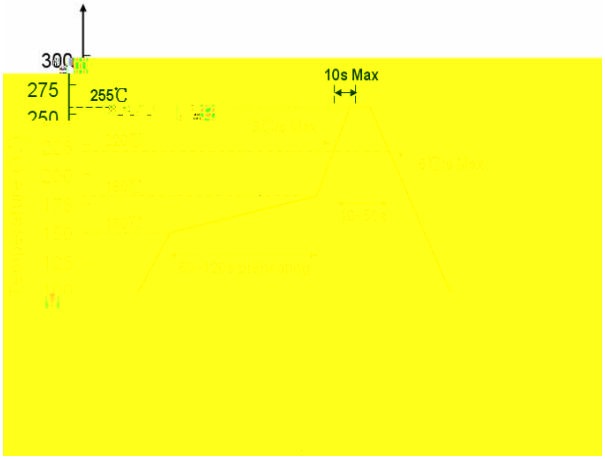

Lead process lead free

Reflow soldering should not be done more than two times.

LED

Stress on the LEDs should be avoided during

使用注意事项（1）

Precautions (1)

1.

Storage

Moisture .
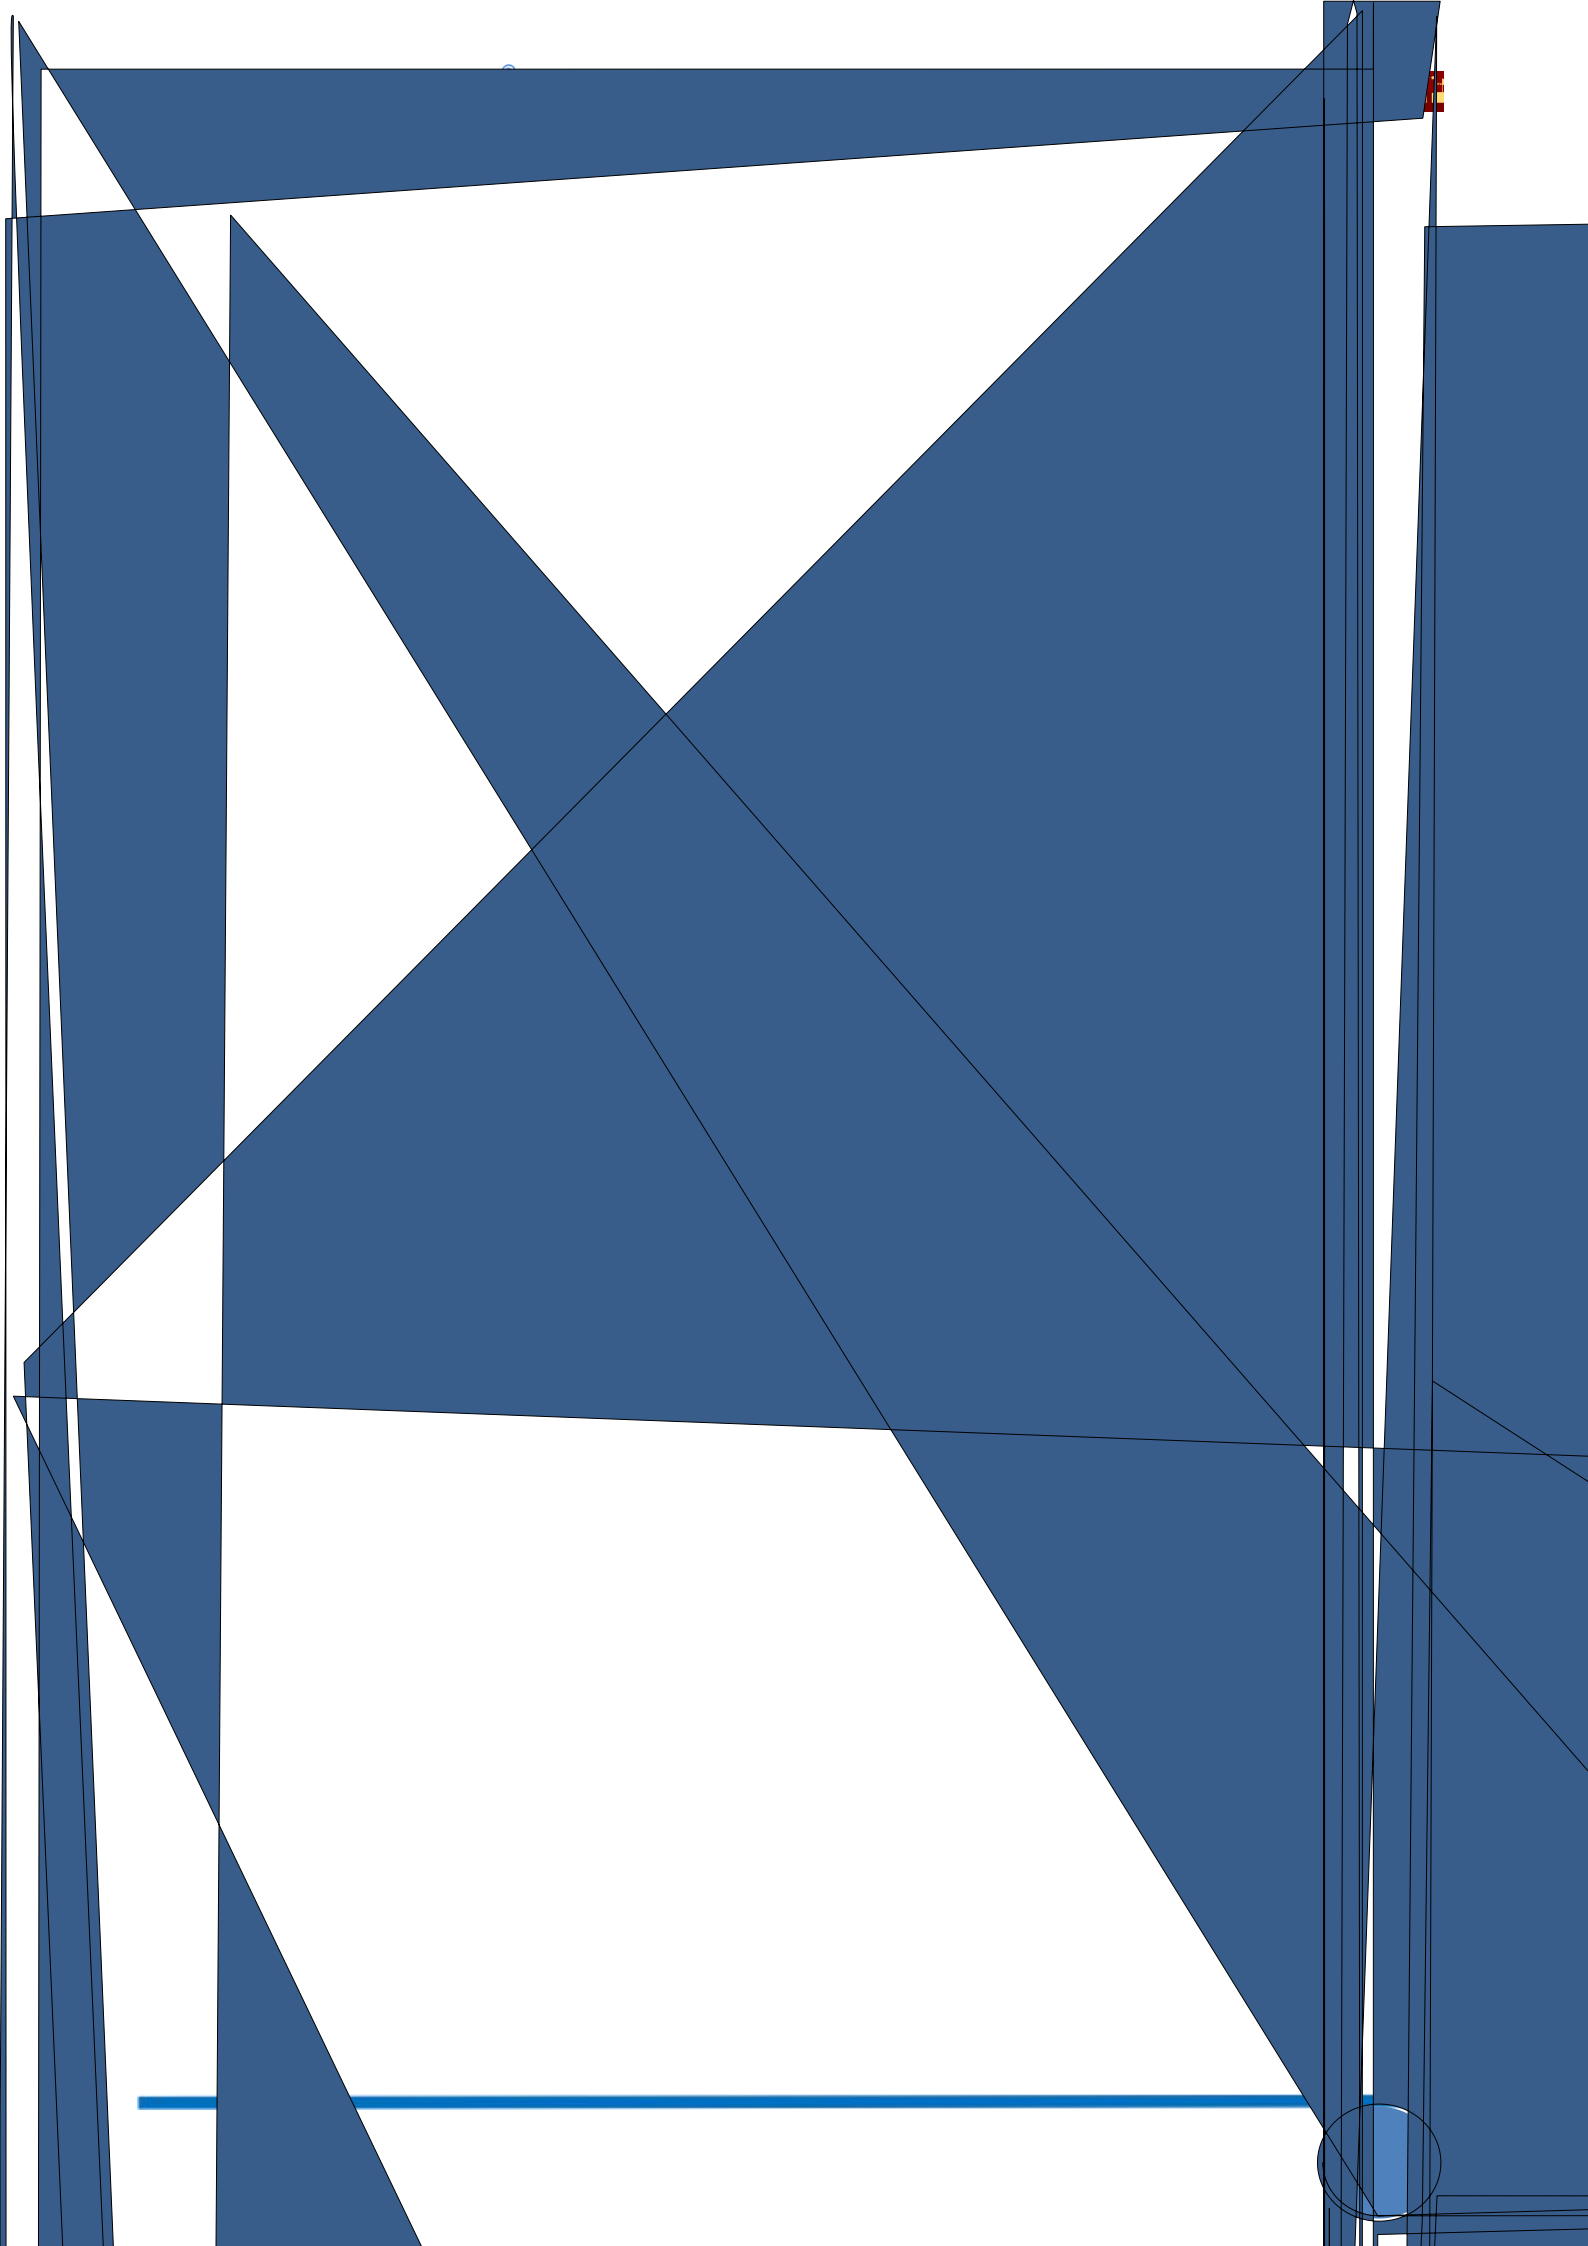
XINGLIGHT®