颜色分档:
Color grading

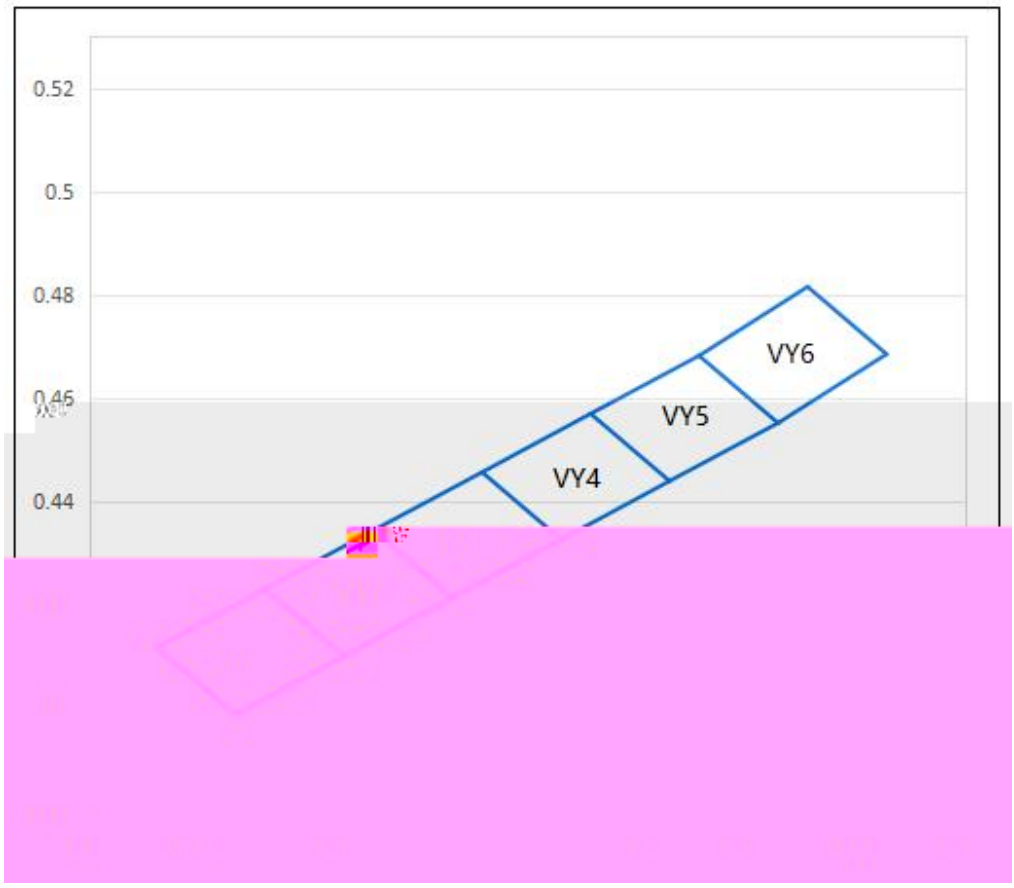

Bin Range of Chromaticity Coordinates

色区	X	Y	X	Y	X	Y	X	Y
VY1	0.4762	0.412	0.4861	0.4233	0.4933	0.4103	0.4834	0.399

XY ±0.01 XY coordinate error ± 0.01

焊接指导（1）

Guideline for Soldering

1. 手工焊接

Hand Soldering

30W

300 3

LED

Manual welding is recommended only for repair and heavy industry situations. A soldering iron of less than 30W is recommended to be used in Hand Soldering. Please keep the temperature of the soldering iron under 300 while soldering. Each terminal of the LED is to go for less than 3 second and for one time only.

Be careful because the damage of the product is often started at the time of the hand soldering.

2. 回流焊接

使用注意事项（1）
Precautions (1)

Storage

Moisture proof and anti-electrostatic package with moisture absorbent material is used, to keep moisture to a

使用注意事项（3）

Precautions (3)

4. 其他事项

Others

When handling [illegible] taminate its surface, but also affect [illegible] esult in catastrophic failure of the L[illegible] t put excessive stress on LEDs, esp[illegible]

[illegible]